2901 Airport Drive, Torrance, California 90505

Phone (310) 539-0508 Fax (310) 539-5198

Page 1 of 2

R22 SERVICE LETTER SL-97 R44 SERVICE LETTER SL-87

R66 SERVICE LETTER SL-44

DATE: 23 June 2023

TO: R22-series, R44-series, & R66 Owners, Operators, and Maintenance Personnel

SUBJECT: Cockpit Camera Firmware (Software) Update

ROTORCRAFT AFFECTED:

- R22-series, R44-series, and R66 helicopters equipped with F039-1/-2/-3 Cockpit Camera delivered before 1 June 2022
- R22-series, R44-series, and R66 helicopters equipped with F039-1/-2/-3 Cockpit Camera installed as KI-271/-275 retrofit kit prior to 1 October 2022

BACKGROUND: RHC has received reports of cockpit cameras malfunctioning due to a camera firmware error. A camera that has already malfunctioned will no longer record video and can only be repaired by returning it to RHC. A user-installable update to cockpit camera firmware is available which reduces likelihood of such malfunction.

COMPLIANCE PROCEDURE:

- 1. Determine firmware version currently installed on cockpit camera:
 - a. Insert a compatible flash drive into cockpit camera (see Cockpit Camera User Guide, Section 7 [available at https://robinsonheli.com/ > Publications > User Guides > Cockpit Camera] for information on compatible flash drives; flash drive supplied with camera is compatible).
 - b. Turn helicopter battery switch ON for approximately 1 minute, then turn battery switch OFF.
 - c. Remove flash drive, insert drive into PC or Mac computer, and open HELICAM_LOG.log file located in HELICAM_LOG folder. The log file can be opened with any standard text editor (i.e. Notepad in Windows or TextEdit on Mac).
 - d. Scroll to bottom of log file, and look for last entry that looks similar to below. Firmware version is listed in "[]" brackets; in below example, firmware version is 1.1.1.4.

firmware version [1.1.1.4] <2022-03-28><12:55:41> UTC:20220328 20:55:41

R22 SL-97 R44 SL-87 R66 SL-44 Page 2 of 2

- 2. Cameras with firmware version 1.1.2.3 or subsequent already include the update and require no further action.
- 3. For cameras with firmware version 1.1.2.2 or prior, update firmware to latest version per instructions in *Cockpit Camera User Guide*, Section 4.
- 4. Make appropriate maintenance record entries.

APPROXIMATE COST:

Parts: No charge.

Labor: Approximately 0.5 labor-hour.